

14401 Keil Road NE, Aurora, Oregon, USA 97002 PHONE 503-678-6545 • FAX 503-678-6560 • <u>www.vansaircraft.com</u> • <u>info@vansaircraft.com</u> Service Letters and Bulletins: <u>www.vansaircraft.com/public/service.htm</u>

SERVICE BULLETIN 14-09-10

Date Released:	September 10, 2014
Date Effective:	September 10, 2014
Subject:	Throttle return spring replacement
Affected Models:	RV-12 aircraft using McFarlane 6818 springs.
Required Action:	Remove and replace affected throttle return springs.
Time of Compliance:	Before further flight
Supersedes Notice:	SB 14-07-29

Labor Required / SLSA Warranty Allowance: N/A

Level of Certification: ELSA - Owner, LSA Repairman Inspection SLSA – N/A

Synopsis:

Field service has shown that McFarlane springs PN 6818 (as referenced in SB 14-07-23) may fail due to engine vibration. All RV-12 owner/operators that received 6818 springs from Van's Aircraft for SB 14-07-23 have been notified prior to the release of this service bulletin. However, it has come to our attention that some RV-12 owner/operators may have received 6818 springs through sources other than Van's Aircraft.

Method of Compliance:

Mcfarlane springs PN 6818, can be identified by a colored stripe along the coils of the spring.

Remove installed 6818 springs and re-install the Rotax springs supplied with your aircraft. If you have installed a new vernier style throttle purchased from McFarlane or another aftermarket supplier contact McFarlane Aviation for an interim solution using McFarlane medium strength spring P/N 6696 as the vernier style throttle is not compatible with the standard Rotax springs.

Van's Aircraft is in the process of testing a replacement for the 6818 spring. This service bulletin will be superseded by a notification allowing the installation of the new replacement springs when they become available.